

PF04G49 *

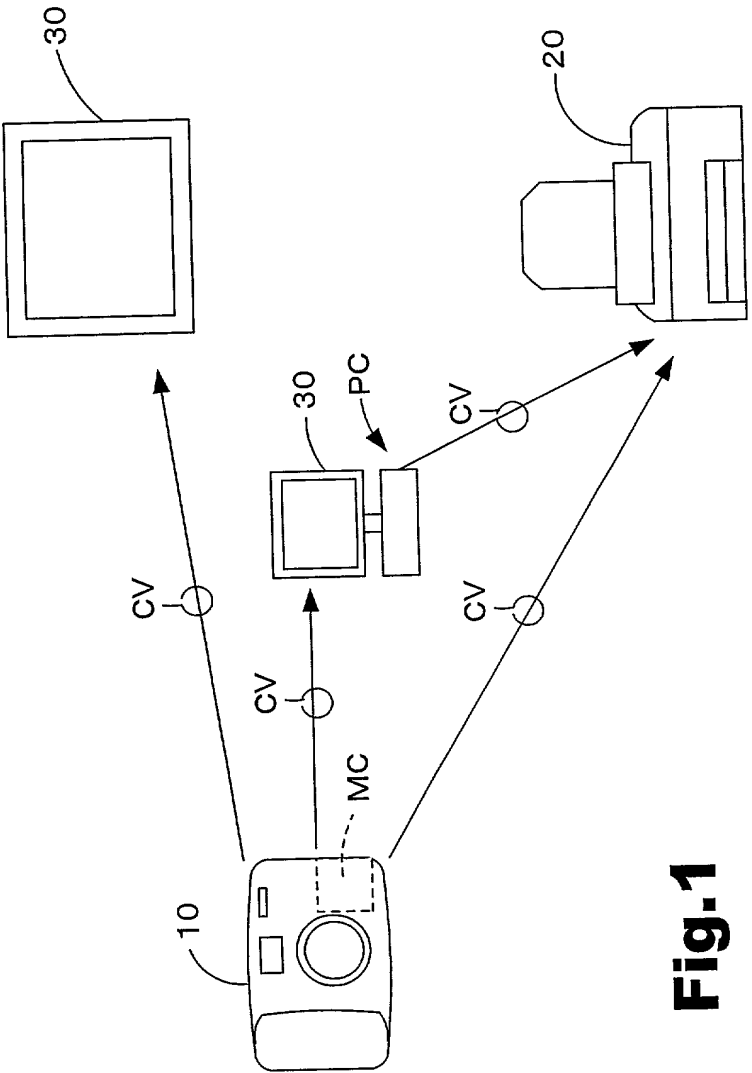


Fig.1

Fig.2

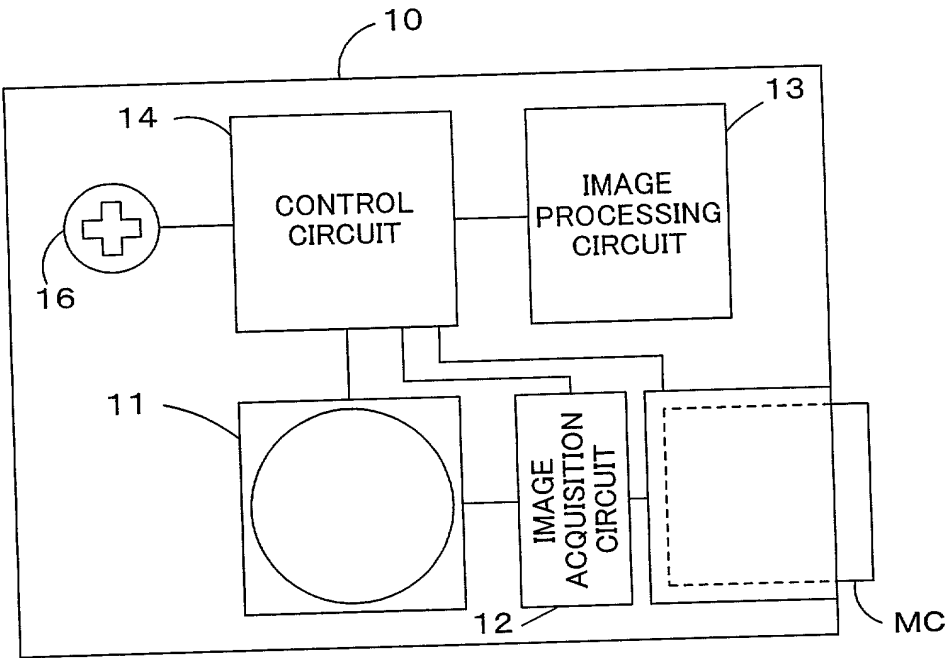


Fig.3

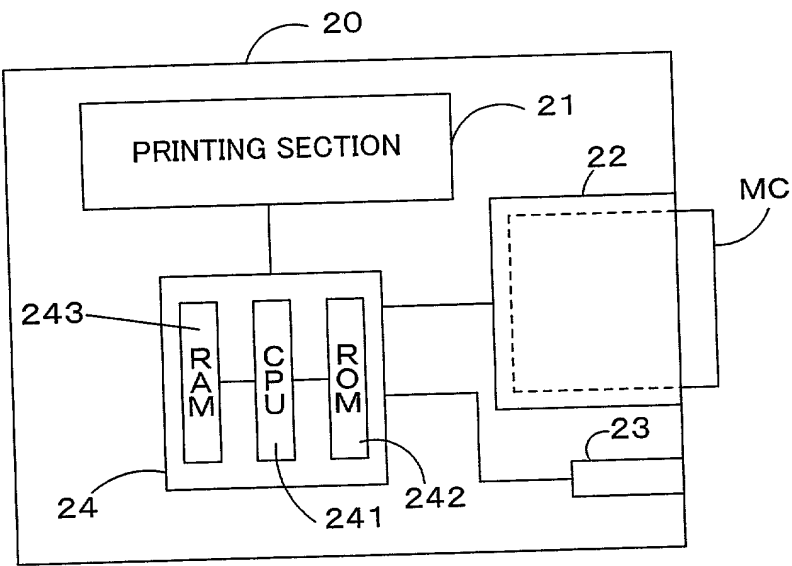


Fig.4

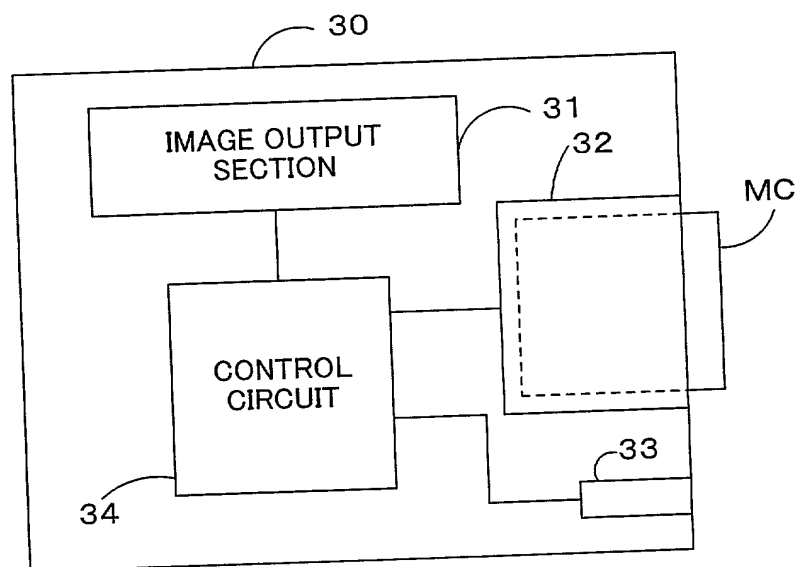


Fig.5

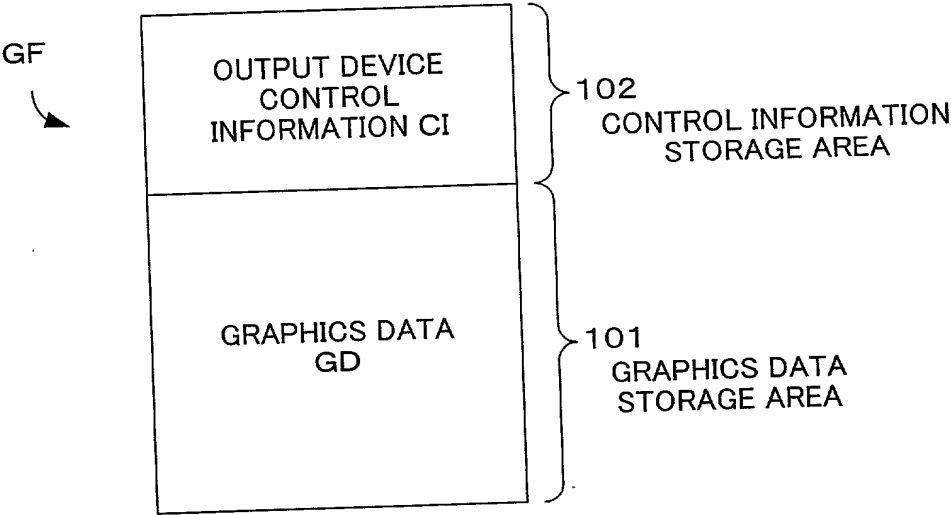


Fig.6

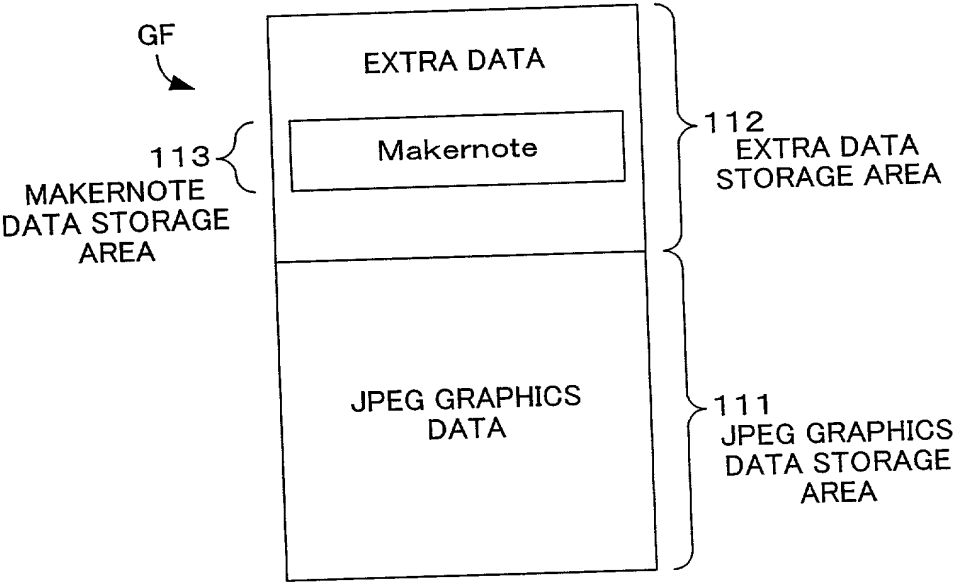


Fig.7

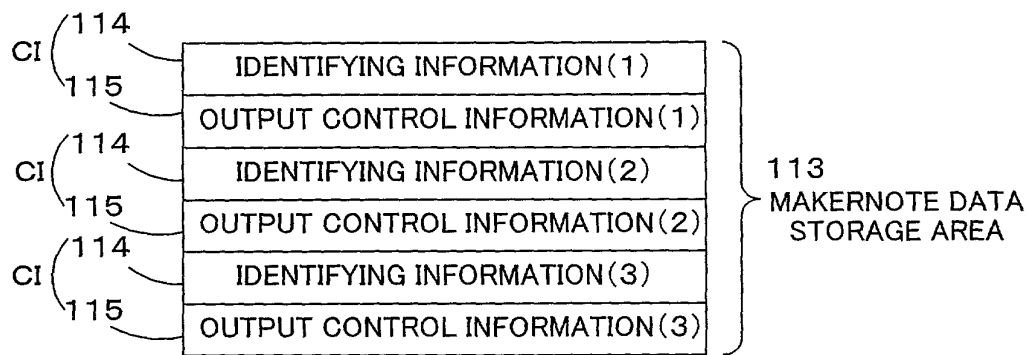


Fig.8

114

DESCRIPTION	SETTING
CONTROL IDENTIFICATION HIERARCHY NUMBER N _c	4
CONTROL CATEGORY IDENTIFIER C-ID ₁	1
CONTROL CATEGORY IDENTIFIER C-ID ₂	3
CONTROL CATEGORY IDENTIFIER C-ID ₃	2
CONTROL CATEGORY IDENTIFIER C-ID ₄	0

Fig.9

DEVICE ID	D-ID ₁	D-ID ₂	D-ID ₃	D-ID ₄
ID SETTING	1:PRINTER	1:ELECTROPHOTOGRAPHIC	1:CO. A	1:AAA
		2:SUBLIMATION	2:CO. B	2:BBB
		3:INK JET	3:CO. C	3:CCC
	2:MONITOR	1:CRT	1:CO. A	1:AAA
		2:TRANSMISSIVE LCD	2:CO. B	2:BBB
		3:REFLECTIVE LCD	3:CO. C	3:CCC
	3:PROJECTOR	1:LCD	1:CO. A	1:AAA
		2:DLP	2:CO. B	2:BBB

Fig.10

115

CONTROL PARAMETER	SETTING
GAMMA CORRECTION VALUE	2. 2
TARGET COLOR SPACE	NTSC
sRGB NEGATIVE VALUE TREATMENT	1 (VALID)
SHADOW	5
HIGHLIGHT	2
CONTRAST	0
BRIGHTNESS	4
RGB COLOR BALANCE	R0/G-1/B2
CHROMATICITY	0
SHARPNESS	THRESHOLD VALUE 2, APPLIED LEVEL 3
STORED COLOR CORRECTION	GREEN 0,0,0 (UNASSIGNED) SAPCE 0,0,0 (UNASSIGNED) SKIN 0,0,0 (UNASSIGNED) RED 0,0,0 (UNASSIGNED)
AUTO ADJUST	5
PAPER	3(PHOTOGRAPHIC PAPER)
RESOLUTION	4(PHOTOGRAPH)
PRINTING DIRECTION	1(ON)

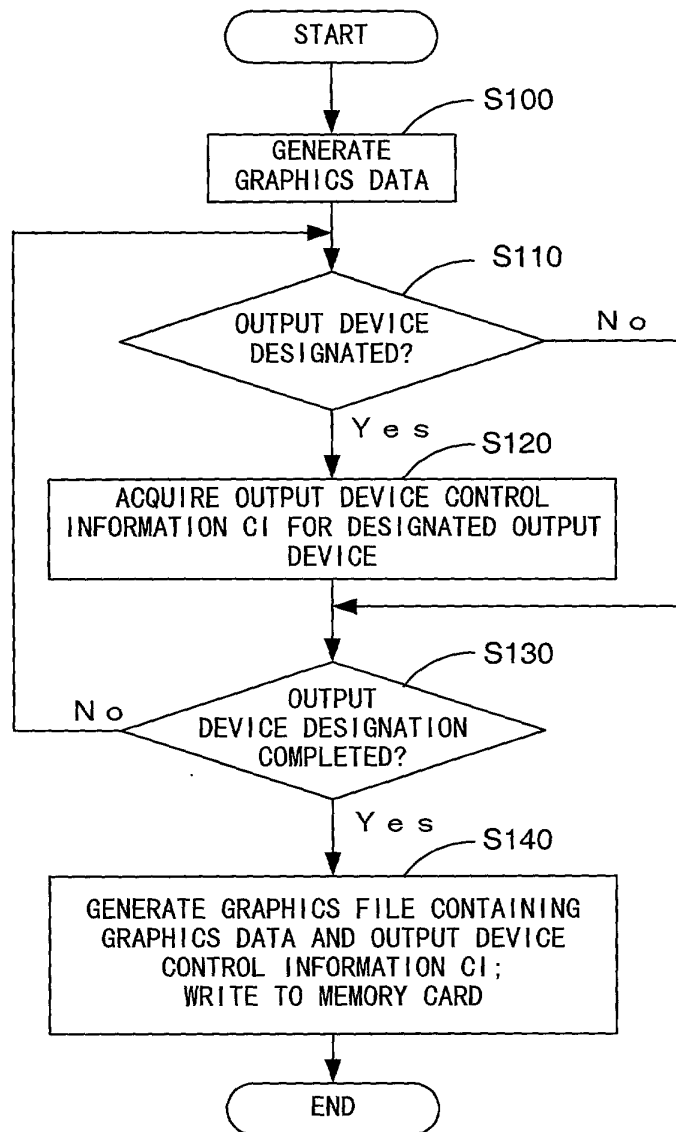
Fig.11

Fig.12

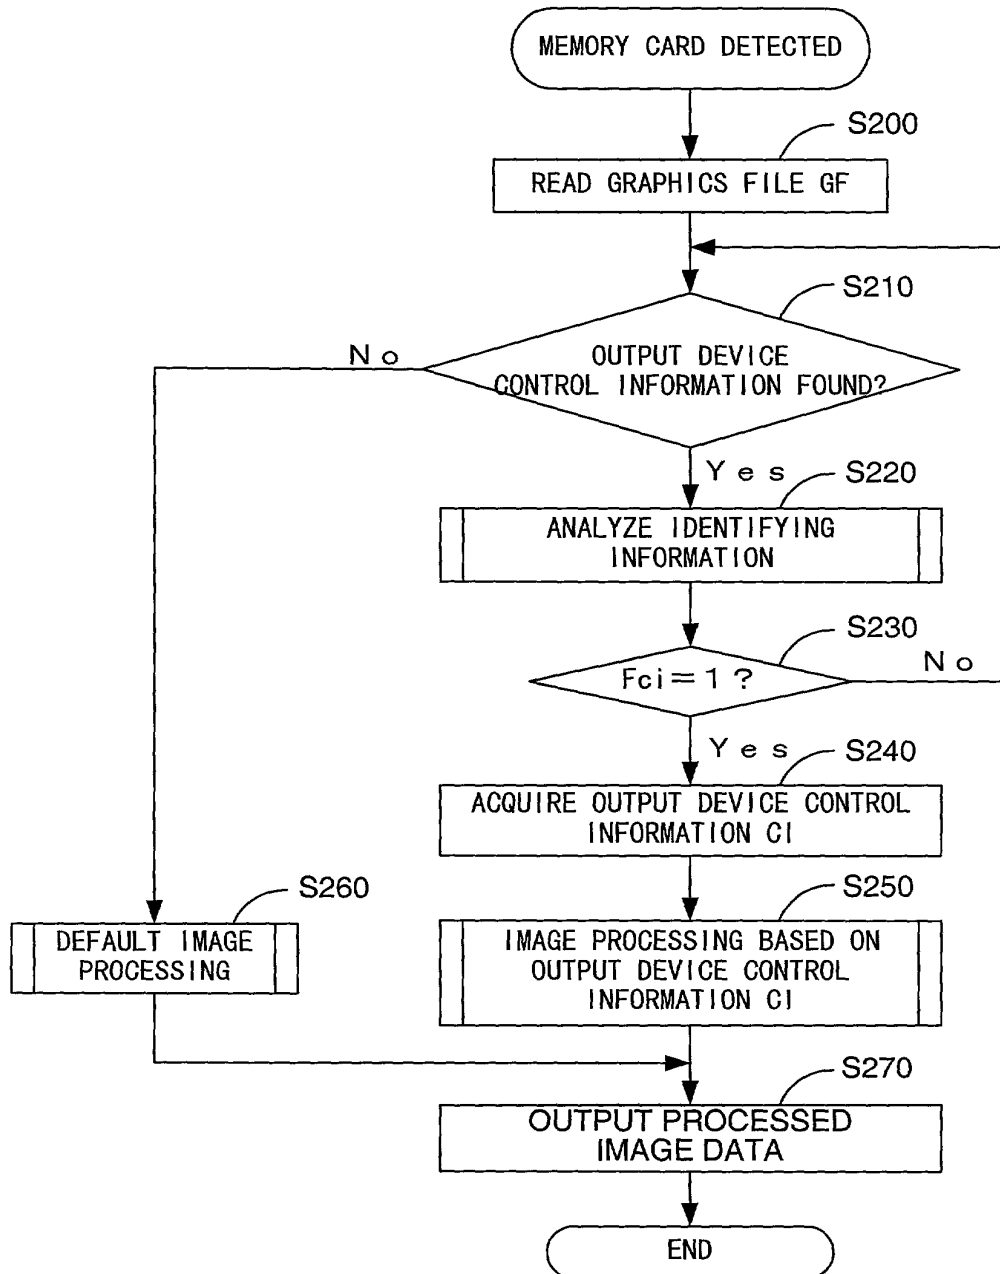


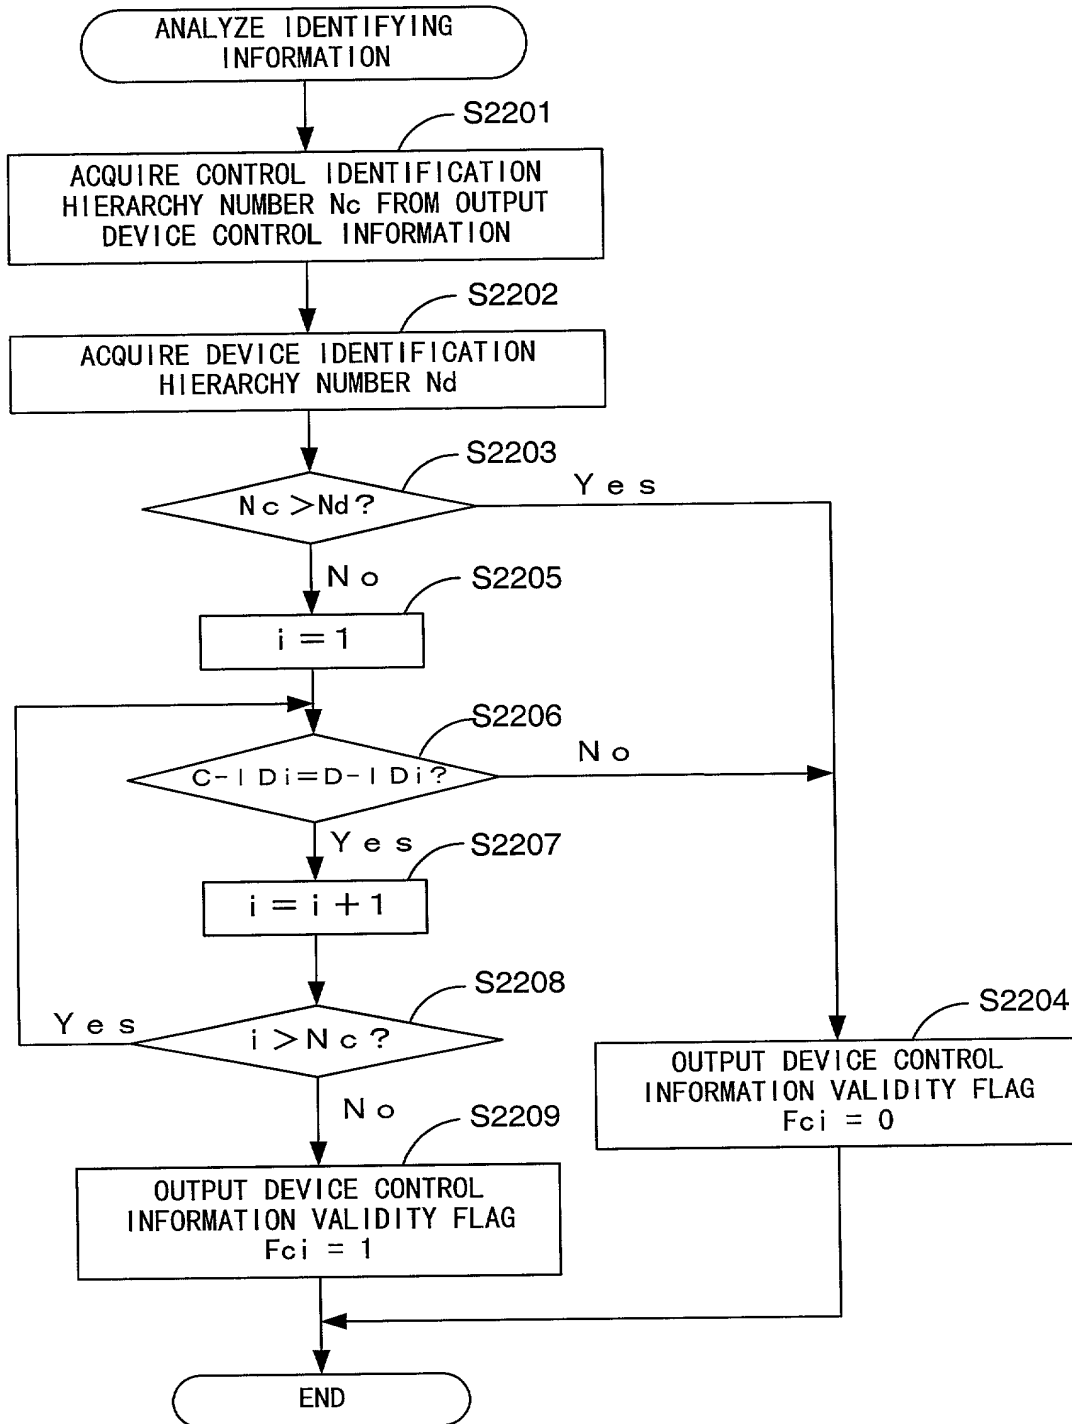
Fig.13

Fig.14

DESCRIPTION	SETTING
DEVICE IDENTIFICATION HIERARCHY NUMBER Nd	4
DEVICE CATEGORY IDENTIFIER D-ID ₁	1
DEVICE CATEGORY IDENTIFIER D-ID ₂	3
DEVICE CATEGORY IDENTIFIER D-ID ₃	2
DEVICE CATEGORY IDENTIFIER D-ID ₄	0

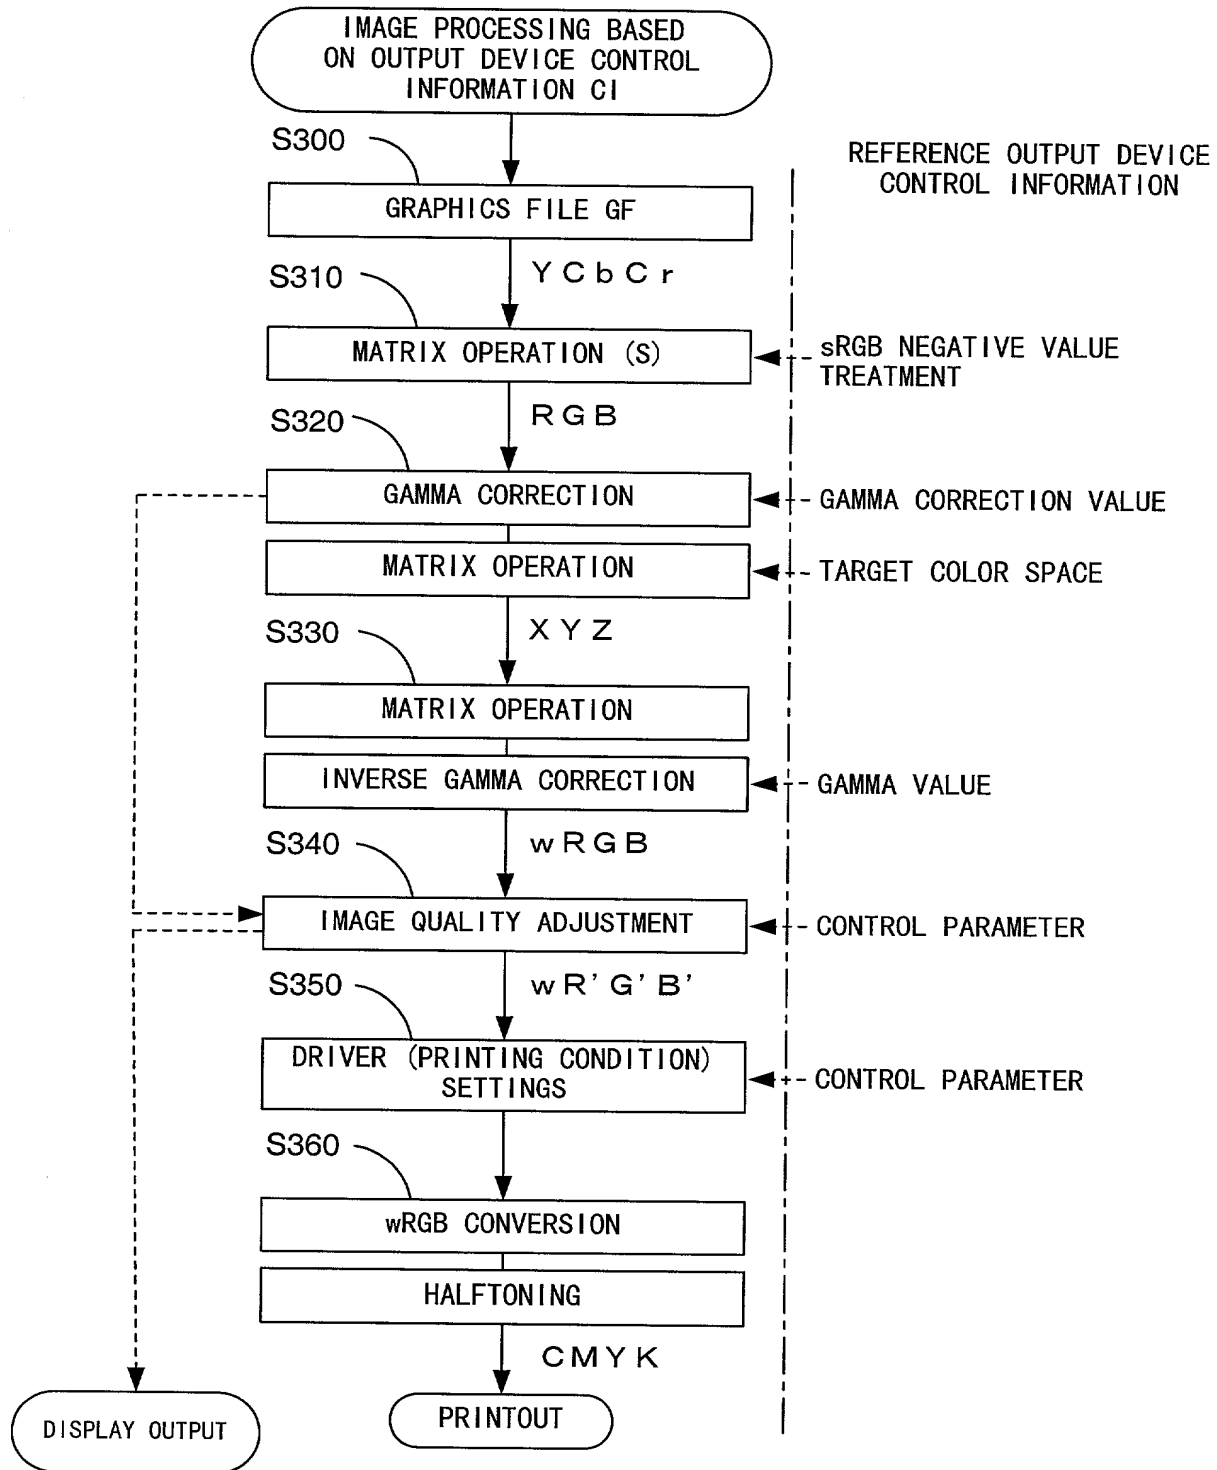
Fig.15

Fig.16

$$\begin{pmatrix} R \\ G \\ B \end{pmatrix} = \mathbf{S} \begin{pmatrix} Y \\ Cb-128 \\ Cr-128 \end{pmatrix}$$

$$\mathbf{S} = \begin{pmatrix} 1 & 0 & 1.40200 \\ 1 & -0.34414 & -0.71414 \\ 1 & 1.77200 & 0 \end{pmatrix}$$

Fig.17

$$\begin{pmatrix} X \\ Y \\ Z \end{pmatrix} = \mathbf{M} \begin{pmatrix} Rt' \\ Gt' \\ Bt' \end{pmatrix} \quad \mathbf{M} = \begin{pmatrix} 0.6067 & 0.1736 & 0.2001 \\ 0.2988 & 0.5868 & 0.1144 \\ 0 & 0.0661 & 1.1150 \end{pmatrix}$$

$$Rt, Gt, Bt \geq 0$$

$$Rt' = \left(\frac{Rt}{255} \right)^r \quad Gt' = \left(\frac{Gt}{255} \right)^r \quad Bt' = \left(\frac{Bt}{255} \right)^r$$

$$Rt, Gt, Bt < 0$$

$$Rt' = - \left(\frac{-Rt}{255} \right)^r \quad Gt' = - \left(\frac{-Gt}{255} \right)^r \quad Bt' = - \left(\frac{-Bt}{255} \right)^r$$

Fig.18

$$\begin{pmatrix} R_w \\ G_w \\ B_w \end{pmatrix} = \mathbf{N}^{-1} \begin{pmatrix} X \\ Y \\ Z \end{pmatrix}$$

$$\mathbf{N}^{-1} = \begin{pmatrix} 3.30572 & -1.77561 & 0.73649 \\ -1.04911 & 2.1694 & -1.4797 \\ 0.0658289 & -0.241078 & 1.24898 \end{pmatrix}$$

$$R_w' = \left(\frac{R_w}{255} \right)^{1/\gamma}$$

$$G_w' = \left(\frac{G_w}{255} \right)^{1/\gamma}$$

$$B_w' = \left(\frac{B_w}{255} \right)^{1/\gamma}$$